


Ultrasonic Sensor Diffuse Mode Sensor RU100U-M18M-UP8X2-H1151

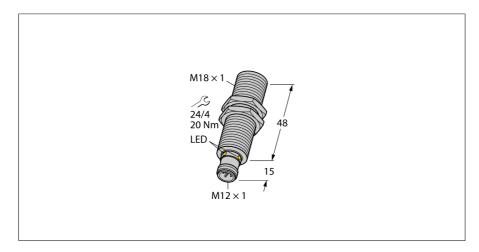

Type designation	RU100U-M18M-UP8X2-H1151
Ident-No.	1610010

Function	Ultrasonic diffuse mode sensor
Range	1501000 mm
Resolution	1 mm
minimum measuring range	100 mm
minimum switching range	10 mm
Ultrasound frequency	200 kHz
Repeat accuracy	0.15 % of full scale
Temperature drift	1.5% of full scale
Linearity error	< ± 0.5 %

Linearity error	\leq ± 0.5 %
Edge lengths of the nominal actuator	100 mm
Approach speed	≤ 8 m/s
Pass speed	≤ 2 m/s

Operating voltage	1530 VDC
Residual ripple	10 % U _{ss}
DC rated operational current	≤ 150 mA
No-load current I₀	≤ 50 mA
Load resistance	\leq 1000 Ω
Residual current	≤ 0.1 mA
Response time typical	90 ms
Readiness delay	300 ms
Output function	NO/NC, PNP
Output 1	Switching output
Switching frequency	6.9 Hz
Hysteresis	≤ 10 mm
Voltage drop at I _e	≤ 2.5 V
Short-circuit protection	yes/ Cyclic
Reverse polarity protection	yes

Wire breakage protection	yes	
Design	Threaded barrel, M18	
Radiation direction	straight	
Dimensions	63 x Ø 18 mm	
Housing material	Metal, CuZn, Nickel-plated	
Transducer material	Plastic, Epoxyd resin and PU foam	
Electrical connection	Connector, M12 × 1, 5-wire	
Protection class	IP67	
Ambient temperature	-25+70 °C	
Storage temperature	-40+80 °C	
Declaration of conformity EN ISO/IEC	EN 60947-5-2	
Vibration resistance	IEC 60068-2	
MTTF	281 years	
MTTF note	acc. to SN 29500 (Ed. 99) 40 °C	

Switching state

LED, Yellow
Object detected

LED, Green

- Smooth sonic transducer face
- Cylindrical housing M18, potted
- Connection via M12 x 1 male
- Temperature compensation


Blind zone: 15 cm
 Range: 100 cm
 Resolution: 1 mm
 Sonic cone angle: 16°

■ 1 × switching output, PNP

Teachable settings

NO/NC programmable

Wiring Diagram

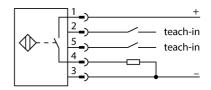


Functional principle

Ultrasonic sensors capture a multitude of objects contactlessly and wear-free with ultrasonic waves. It does not matter whether the object is transparent or opaque, metallic or non-metallic, firm, liquid or powdery. Even environmental conditions such as spray, dust or rain hardly affect their function.

The sonic cone diagram indicates the detection range of the sensor. In accordance with standard EN 60947-5-2, quadratic targets in a range of sizes ($20 \times 20 \text{ mm}$, $100 \times 100 \text{ mm}$) and a round rod with a diameter of 27 mm are used.

Important: The detection ranges for other targets may differ from those for standard targets due to the different reflection properties and geometries.


Sonic Cone

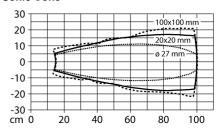



Ultrasonic Sensor Diffuse Mode Sensor RU100U-M18M-UP8X2-H1151

Mounting instructions/Description

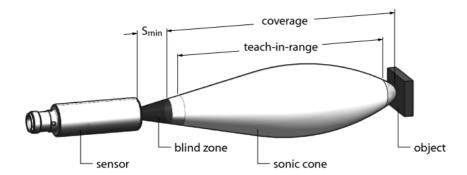

Setting the switching point

The ultrasonic sensor features a switching output with a teachable switching point. The green and yellow LEDs indicate whether the sensor has detected the object.

One switching point is taught. This must be within the detection range. In this operating mode the background is suppressed.

Easy-Teach

Connect the TX1-Q20L60 teach adapter between the sensor and connection cable

Place object at the end of the switching range Press and hold button for at least 2 s against Gnd After a successful teach-in, the green LED flashes at 3 Hz and the sensor runs automatically in normal

To invert the output function, press and hold the button against the Ub for 2...7s

LED response

In standard operating mode, the two LEDs indicate the switching state of the sensor.

Green: Object within the detection range but not in switching range

Yellow: Object is within the switching range

Off: Object is outside the detection range or signal loss



Ultrasonic Sensor Diffuse Mode Sensor RU100U-M18M-UP8X2-H1151

Accessories

Type code	Ident-No.	Description	Dimension drawing
MW-18	6945004	Mounting bracket for threaded barrel sensors; material: Stain-	19,7
		less steel A2 1.4301 (AISI 304)	5.5 9.5 44.5 1.8 7.9

Function accessories

Type code	Ident-No.	Description	Dimension drawing
TX1-Q20L60	6967114	Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors	60 20 M12x1 50 M12x1 42.5