


# Ultrasonic Sensor Diffuse Mode Sensor RU130U-M18ES-LI8X2-H1151

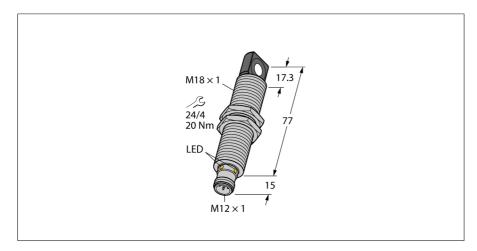

| Type designation | RU130U-M18ES-LI8X2-H1151 |
|------------------|--------------------------|
| Ident-No.        | 1610098                  |

| Function                             | Ultrasonic diffuse mode sensor |
|--------------------------------------|--------------------------------|
| Range                                | 1501300 mm                     |
| Resolution                           | 1 mm                           |
| minimum measuring range              | 100 mm                         |
| minimum switching range              | 10 mm                          |
| Ultrasound frequency                 | 200 kHz                        |
| Repeat accuracy                      | 0.15 % of full scale           |
| Temperature drift                    | 1.5% of full scale             |
| Linearity error                      | ≤ ± 0.5 %                      |
| Edge lengths of the nominal actuator | 100 mm                         |
| Annroach speed                       | < 10 m/s                       |

≤ 2 m/s

| Operating voltage               | 1530 VDC             |
|---------------------------------|----------------------|
| Residual ripple                 | 10 % U <sub>ss</sub> |
| DC rated operational current    | ≤ 150 mA             |
| No-load current I₀              | ≤ 50 mA              |
| Load resistance                 | $\leq$ 1000 $\Omega$ |
| Response time typical           | 90 ms                |
| Readiness delay                 | 300 ms               |
| Output 1                        | Analog output        |
| Current output                  | 420 mA               |
| Load resistance, current output | $\leq 0.5~k\Omega$   |
| Switching frequency             | 6.9 Hz               |
| Short-circuit protection        | yes/ Cyclic          |
| Reverse polarity protection     | yes                  |
| Mira brackaga protection        |                      |

| Wire breakage protection             | yes                               |  |
|--------------------------------------|-----------------------------------|--|
| Design                               | Threaded barrel, M18              |  |
| Radiation direction                  | side                              |  |
| Dimensions                           | 92 x Ø 18 mm                      |  |
| Housing material                     | Metal, CuZn, Nickel-plated        |  |
| Transducer material                  | Plastic, Epoxyd resin and PU foam |  |
| Electrical connection                | Connector, M12 × 1, 5-wire        |  |
| Protection class                     | IP67                              |  |
| Ambient temperature                  | -25+70 °C                         |  |
| Storage temperature                  | -40+80 °C                         |  |
| Declaration of conformity EN ISO/IEC | EN 60947-5-7                      |  |
| Vibration resistance                 | IEC 60068-2                       |  |
| MTTF                                 | 202 years                         |  |
| MTTF note                            | acc. to SN 29500 (Ed. 99) 40 °C   |  |
|                                      |                                   |  |

LED, Yellow


LED, Green

#### Rectangular transducer front

- Cylindrical housing M18, potted
- Connection via M12 x 1 male
- Teach range adjustable via adapter
- Temperature compensation

Blind zone: 15 cm
 Range: 130 cm
 Resolution: 1 mm
 Sonic cone angle: 16°
 analog output, 4...20mA

#### Wiring Diagram

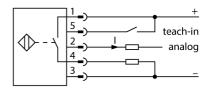


### **Functional principle**

Ultrasonic sensors capture a multitude of objects contactlessly and wear-free with ultrasonic waves. It does not matter whether the object is transparent or opaque, metallic or non-metallic, firm, liquid or powdery. Even environmental conditions such as spray, dust or rain hardly affect their function.

The sonic cone diagram indicates the detection range of the sensor. In accordance with standard EN 60947-5-7, quadratic targets in a range of sizes (20 x 20 mm, 100 x 100 mm) and a round rod with a diameter of 27 mm are

Important: The detection ranges for other targets may differ from those for standard targets due to the different reflection properties and geometries.

#### **Sonic Cone**

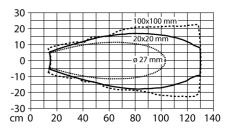

Switching state


Object detected

Pass speed

# TURCK Your Global Automation Partner

# Ultrasonic Sensor Diffuse Mode Sensor RU130U-M18ES-LI8X2-H1151

#### Mounting instructions/Description

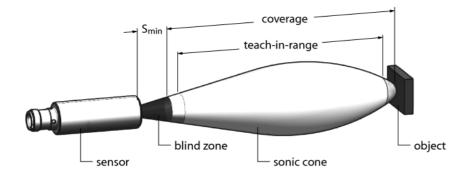

#### Setting the limit values

The ultrasonic sensor has an analog output with teachable measuring range. Teaching is implemented via the teach adapter. The green and yellow LEDs indicate whether the sensor has detected the object.

#### Teach

Connect the TX1-Q20L60 teach adapter between the sensor and connection cable

- Position object for remote limit value
- Press the button against Ub for 2 7 seconds
- Position object for close limit value
- Press the button against Ub for 8 11 seconds Optional: Inversion of analog output
- Press the button for 12 17 seconds

#### LED response

Successful teaching is displayed with a fast flashing LED. Thereafter, the sensor automatically runs in normal operating mode. Unsuccessful teaching is indicated by the LED flashing alternately green and yellow. In normal operation, the two LEDs indicate the status of the sensor.

- Green: Object within the detection range, but not in the measuring range
- Yellow: Object is within the measuring range
- Off: Object outside the detection range or signal loss



# **Ultrasonic Sensor Diffuse Mode Sensor** RU130U-M18ES-LI8X2-H1151

## **Accessories**

| Type code | Ident-No. | Description  | Dimension drawing  |
|-----------|-----------|--|--|
| MW-18     | 6945004   | Mounting bracket for threaded barrel sensors; material: Stain- | 19,7   |
|           |           | less steel A2 1.4301 (AISI 304)                                | 5,5<br>9,5,5<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1<br>10,1 |

## **Function accessories**

| Type code  | Ident-No. | Description   | Dimension drawing |
|------------|-----------|---|-------------------|
| TX1-Q20L60 | 6967114   | Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors | 8 04.5 015 M12x1  |