


## Ultrasonic Sensor Diffuse Mode Sensor RU300U-M30E-LU8X2-H1151

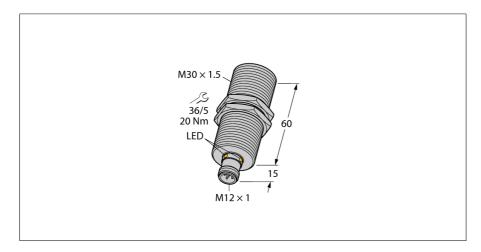

Type designation	RU300U-M30E-LU8X2-H1151
Ident-No.	1610113

Function Ultrasonic diffuse mode sensor 300...3000 mm Range Resolution 1 mm minimum measuring range 250 mm minimum switching range 25 mm Ultrasound frequency 120 kHz Repeat accuracy 0.15 % of full scale Temperature drift 1.5% of full scale < + 0.5 %

Operating voltage 15...30 VDC Residual ripple 10 % U., DC rated operational current ≤ 150 mA  $\leq$  50 mA No-load current I Load resistance  $\leq$  1000  $\Omega$ Response time typical 190 ms Readiness delay 300 ms Output 1 Analog output 0...10V Voltage output Load resistance voltage output  $\geq 1 \; k\Omega$ Switching frequency 3.3 Hz Short-circuit protection yes/ Cyclic Reverse polarity protection ves Wire breakage protection ves

yes	
Threaded barrel, M30	
straight	
75 x Ø 30 mm	
Metal, CuZn, Nickel-plated	
Plastic, Epoxyd resin and PU foam	
Connector, M12 × 1, 5-wire	
IP67	
-25+70 °C	
-40+80 °C	
EN 60947-5-7	
IEC 60068-2	
191 years	
acc. to SN 29500 (Ed. 99) 40 °C	

LED, Yellow

LED, Green


#### ■ Smooth sonic transducer face

- Cylindrical housing M30, potted
- Connection via M12 × 1 male connector
- Measuring range adjustable via Easy-Teach
- Temperature compensation

Blind zone: 30 cm
Range: 300 cm
Resolution: 1 mm
Sonic cone angle: 15°

 1x analog output, 0..10V/additional switching output, PNP

#### Wiring Diagram

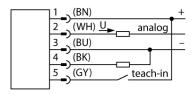


#### **Functional principle**

Ultrasonic sensors capture a multitude of objects contactlessly and wear-free with ultrasonic waves. It does not matter whether the object is transparent or opaque, metallic or non-metallic, firm, liquid or powdery. Even environmental conditions such as spray, dust or rain hardly affect their function.

The sonic cone diagram indicates the detection range of the sensor. In accordance with standard EN 60947-5-7, quadratic targets in a range of sizes ( $20 \times 20 \text{ mm}$ ,  $100 \times 100 \text{ mm}$ ) and a round rod with a diameter of 27 mm are used

Important: The detection ranges for other targets may differ from those for standard targets due to the different reflection properties and geometries.

#### **Sonic Cone**

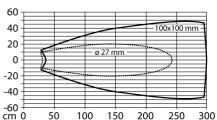


Switching state

Object detected

# TURCK Your Global Automation Partner

## Ultrasonic Sensor Diffuse Mode Sensor RU300U-M30E-LU8X2-H1151

Mounting instructions/Description

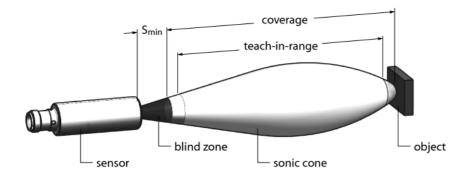

#### Setting the limit values

The ultrasonic sensor has an analog output with teachable measuring range. Teaching is implemented via the teach adapter. The green and yellow LEDs indicate whether the sensor has detected the object.

#### Teach

Connect the TX1-Q20L60 teach adapter between the sensor and connection cable

- Position object for remote limit value
- Press the button against Ub for 2 7 seconds
- Position object for close limit value
- Press the button against Ub for 8 11 seconds Optional: Inversion of analog output
- Press the button for 12 17 seconds

#### LED response

Successful teaching is displayed with a fast flashing LED. Thereafter, the sensor automatically runs in normal operating mode. Unsuccessful teaching is indicated by the LED flashing alternately green and yellow. In normal operation, the two LEDs indicate the status of the sensor.

- Green: Object within the detection range, but not in the measuring range
- Yellow: Object is within the measuring range
- Off: Object outside the detection range or signal loss



# **Ultrasonic Sensor Diffuse Mode Sensor** RU300U-M30E-LU8X2-H1151

## **Accessories**

Type code	Ident-No.	Description	Dimension drawing
MW-30	6945005	Mounting bracket for threaded barrel sensors; material: Stainless steel A2 1.4301 (AISI 304)	30.5 119.1 12.2 34.8 57.2 10.3

## **Function accessories**

Type code	Ident-No.	Description	Dimension drawing
TX1-Q20L60	6967114	Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors	8 04.5 015 M12×1