


Ultrasonic Sensor Diffuse Mode Sensor RU100U-EMT18E-LI8X2-H1151

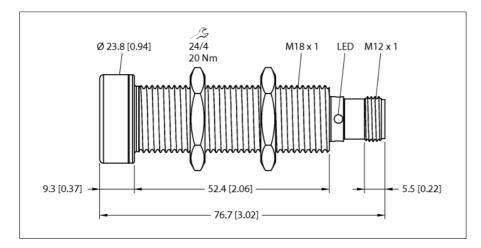

Type designation	RU100U-EMT18E-LI8X2-H1151
Ident-No.	100003035

Function	Ultrasonic diffuse mode sensor	
Range	1501000 mm	
Resolution	1 mm	
minimum measuring range	100 mm	
minimum switching range	10 mm	
Ultrasound frequency	200 kHz	
Repeat accuracy	0.15 % of full scale	
Temperature drift	1.5% of full scale	
Linearity error	≤ ± 0.5 %	
Edge lengths of the nominal actuator	100 mm	
Approach speed	≤ 8 m/s	
Pass speed	≤ 2 m/s	

Pass speed	≤ 2 m/s	
Occupant to the control of the contr	45 00 1/00	
Operating voltage	1530 VDC	
Residual ripple	10 % U _{ss}	
DC rated operational current	≤ 150 mA	
No-load current I₀	≤ 50 mA	
Load resistance	≤ 1000 Ω	
Response time typical	90 ms	
Readiness delay	300 ms	
Output 1	Analog output	
Current output	420 mA	
Load resistance, current output	$\leq 0.5 \ k\Omega$	
Switching frequency	6.9 Hz	
Short-circuit protection	yes/ Cyclic	
Reverse polarity protection	yes	
Wire breakage protection	yes	

Design	Threaded barrel, M18	
Radiation direction	straight	
Dimensions	75 x Ø 18 mm	
Housing material	Stainless steel, V4A 1.4404 (AISI 316L), PTFE-coated	
Transducer material	Plastic, Epoxy resin and PU foam with PTFE coating	
Electrical connection	Connector, M12 × 1, 5-wire	
Protection class	IP67	
Ambient temperature	-5+50 °C	
Storage temperature	-40+50 °C	
Declaration of conformity EN ISO/IEC	EN 60947-5-7	
Vibration resistance	IEC 60068-2	
MTTF note	acc. to SN 29500 (Ed. 99) 40 °C	

LED, Yellow

LED, Green

■ Sc	onic tr	ansduce	r face	with	PTFE	layer
------	---------	---------	--------	------	------	-------

Stainless steel front attachment


Cylindrical housing M18, potted

■ Connection via M12 × 1 male connector

■ Temperature compensation

Blind zone: 15 cm
Range: 100 cm
Resolution: 1 mm
Sonic cone angle: 16°
analog output, 4...20mA

Wiring Diagram

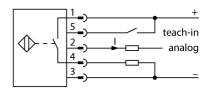


Functional principle

Ultrasonic sensors capture a multitude of objects contactlessly and wear-free with ultrasonic waves. It does not matter whether the object is transparent or opaque, metallic or non-metallic, firm, liquid or powdery. Even environmental conditions such as spray, dust or rain hardly affect their function.

The sonic cone diagram indicates the detection range of the sensor. In accordance with standard EN 60947-5-7, quadratic targets in a range of sizes (20 x 20 mm, 100 x 100 mm) and a round rod with a diameter of 27 mm are

Important: The detection ranges for other targets may differ from those for standard targets due to the different reflection properties and geometries.

Sonic Cone

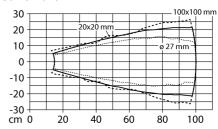


Switching state

Object detected

TURCK Your Global Automation Partner

Ultrasonic Sensor Diffuse Mode Sensor RU100U-EMT18E-LI8X2-H1151

Mounting instructions/Description

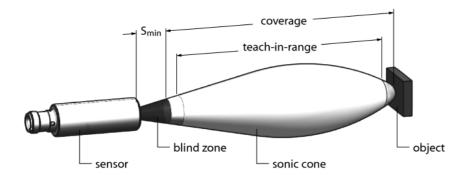

Setting the limit values

The ultrasonic sensor has an analog output with teachable measuring range. Teaching is implemented via the teach adapter. The green and yellow LEDs indicate whether the sensor has detected the object.

Teach

Connect the TX1-Q20L60 teach adapter between the sensor and connection cable

- Position object for remote limit value
- Press the button against Ub for 2 7 seconds
- Position object for close limit value
- Press the button against Ub for 8 11 seconds Optional: Inversion of analog output
- Press the button for 12 17 seconds

LED response

Successful teaching is displayed with a fast flashing LED. Thereafter, the sensor automatically runs in normal operating mode. Unsuccessful teaching is indicated by the LED flashing alternately green and yellow. In normal operation, the two LEDs indicate the status of the sensor.

- Green: Object within the detection range, but not in the measuring range
- Yellow: Object is within the measuring range
- Off: Object outside the detection range or signal loss



Ultrasonic Sensor Diffuse Mode Sensor RU100U-EMT18E-LI8X2-H1151

Accessories

Type code	Ident-No.	Description	Dimension drawing
MW-18	6945004	Mounting bracket for threaded barrel sensors; material: Stainless steel A2 1.4301 (AISI 304)	5,5 15,9 15,9 19,1 16,9 19,1 16,9 19,1 14,3 34,8

Function accessories

Type code	Ident-No.	Description	Dimension drawing
TX1-Q20L60	6967114	Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors	8 04.5 015 M12x1