


# Flow monitoring Immersion sensor with integrated processor FCS-N1/2A4P-ARX-B3141/115VAC

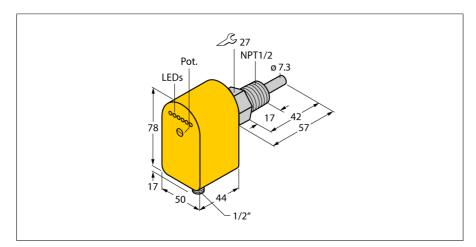

Flow	sensor	for	liquid	media

- Calorimetric principle
- Adjustment via potentiometer
- **LED** band
- AC 4-wire, 98...132 VAC
- NO contact, relay output
- Plug-in device, 1/2"

# Wiring Diagram





Type designation Ident-No.

### FCS-N1/2A4P-ARX-B3141/115VAC 6871037

## Mounting

Immersion sensor Water Operating Range 1...150 cm/s Oil Operating Range 3...300 cm/s Stand-by time typ. 8 s (2...15 s) Switch-on time typ. 2 s (1...15 s) Switch-off time typ. 2 s (1...15 s) Temperature jump, response time max. 12 s Temperature gradient ≤ 250 K/min

## Operating voltage

Medium temperature

Output function Rated operational current Short-circuit protection AC switching voltage DC switching voltage Max. AC switching capacity Max. DC switching capacity

## 98...132VAC

-20...+80 °C

Relay output, NO contact

60 VDC 500 VA 50 W

250 VAC IP67

# Design

Housing material Sensor material

Max. tightening torque housing nut Electrical connection

Pressure resistance Process connection

# 2 A

# Immersion

Plastic, PBT

Stainless steel, V4A (1.4571)

LED chain, Green/Yellow/Red

30 Nm Connector, 1/2" 100 bar NPT 1/2"

## Switching state

Protection class

Flow state display LED chain LED red Indication: Drop below setpoint Indication: Setpoint reached LED yellow Indication: Setpoint exceeded 4 x LEDs green

# **Functional principle**

Our insertion - flow sensors operate on the principle of thermodynamics. The measuring probe is heated by several °C as against the flow medium. When fluid moves along the probe, the heat generated in the probe is dissipated. The resulting temperature is measured and compared to the medium temperature. The flow status of every medium can be derived from the evaluated temperature difference. Thus TURCK's wear-free flow sensors reliably monitor the flow of gaseous and liquid media.