


## Flow monitoring Immersion sensor with integrated processor FCS-N1/2A4P-ARX-B1151/L060/115VAC

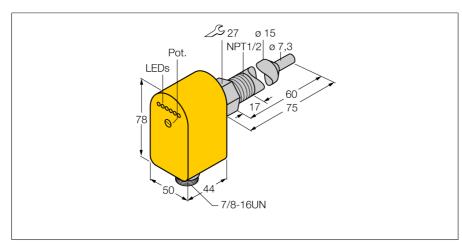

Type designation	FCS-N1/2A4P-ARX-B1151/L060/115VAC
Ident-No.	6871044

Mounting	Immersion sensor
Water Operating Range	1150 cm/s
Oil Operating Range	3300 cm/s
Stand-by time	typ. 8 s (215 s)
Switch-on time	typ. 2 s (115 s)
Switch-off time	typ. 2 s (115 s)
Temperature jump, response time	max. 12 s
Temperature gradient	≤ 250 K/min
Medium temperature	-20+80 °C

Operating voltage	98	.132VA0

opoluting voltage	001024710
Output function	Relay output, NO contact
Rated operational current	2 A
Short-circuit protection	no
AC switching voltage	250 VAC
DC switching voltage	60 VDC
Max. AC switching capacity	500 VA
Max. DC switching capacity	50 W
Protection class	IP67

Design	Immersion
Housing material	Plastic, PBT

Sensor material Stainless steel, V4A (1.4571)

Max. tightening torque housing nut30 NmElectrical connectionConnector, 7/8"Pressure resistance100 barProcess connectionNPT ½"

Switching state LED chain, Green/Yellow/Red

Flow state display

Indication: Drop below setpoint

Indication: Setpoint reached

Indication: Setpoint exceeded


LED yellow

Indication: Setpoint exceeded

4 x LEDs green

- Flow sensor for liquid media
- Calorimetric principle
- Adjustment via potentiometer
- LED band
- AC 5-wire, 98...132 VAC
- NO contact, relay output
- Plug-in device, 7/8"-16UN

## Wiring Diagram





## **Functional principle**

Our insertion - flow sensors operate on the principle of thermodynamics. The measuring probe is heated by several °C as against the flow medium. When fluid moves along the probe, the heat generated in the probe is dissipated. The resulting temperature is measured and compared to the medium temperature. The flow status of every medium can be derived from the evaluated temperature difference. Thus TURCK's wear-free flow sensors reliably monitor the flow of gaseous and liquid media.